



Transport Accident  
Investigation  
Commission

# Final Report

***Marine inquiry MO-2020-202***

***Bulk log carrier Funing***

***Loss of manoeuvrability while leaving port***

***Port of Tauranga***

***6 July 2020***

February 2022



## About the Transport Accident Investigation Commission

---

The Transport Accident Investigation Commission (Commission) is a standing commission of inquiry and an independent Crown entity responsible for inquiring into maritime, aviation and rail accidents and incidents for New Zealand, and co-ordinating and co-operating with other accident investigation organisations overseas.

The principal purpose of its inquiries is to determine the circumstances and causes of occurrences with a view to avoiding similar occurrences in the future. It is not the Commission's purpose to ascribe blame to any person or agency or to pursue (or to assist an agency to pursue) criminal, civil or regulatory action against a person or agency. However, the Commission will not refrain from fully reporting on the circumstances and factors contributing to an accident because fault or liability may be inferred from the findings.

# Notes about Commission reports

---

## **Commissioners**

Chief Commissioner	Jane Meares
Deputy Chief Commissioner	Stephen Davies Howard
Commissioner	Richard Marchant
Commissioner	Paula Rose, QSO

## **Key Commission personnel**

Chief Executive	Martin Sawyers
Chief Investigator of Accidents	Harald Hendel
Investigator in Charge	Robert Thompson
Commission General Counsel	Cathryn Bridge

## **Citations and referencing**

This report does not cite information derived from interviews during the Commission's inquiry into the occurrence. Documents normally accessible to industry participants only and not discoverable under the Official Information Act 1982 are referenced as footnotes only. Publicly available documents referred to during the Commission's inquiry are cited.

## **Photographs, diagrams, pictures**

The Commission has provided, and owns, the photographs, diagrams and pictures in this report unless otherwise specified.

## **Verbal probability expressions**

Where possible, the Commission uses standardised terminology in its reports. This is for the benefit of investigation participants, readers of its reports, and recipients of its recommendations. One example of this standardisation is the terminology used to describe the degree of probability (or likelihood) that an event happened, or a condition existed in support of a hypothesis.


This terminology, set out in the table below, has been adopted by the Commission based on the Intergovernmental Panel on Climate Change and Australian Transport Safety Bureau models. The Commission chose these models due their simplicity, usability, and international use. The Commission considers the suitability of these models as being reflective of the Commission's functions, which include the making of findings and recommendations based on a wide range of evidence received, whether or not that evidence would be admissible in a Court of law.

Terminology	Likelihood	Equivalent terms
Virtually certain	> 99% probability of occurrence	Almost certain
Very likely	> 90% probability	Highly likely, very probable
Likely	> 66% probability	Probable
About as likely as not	33% to 66% probability	More or less likely
Unlikely	< 33% probability	Improbable
Very unlikely	< 10% probability	Highly unlikely
Exceptionally unlikely	< 1% probability	



**Figure 1: The *Funing***  
**(Credit: Owen Foley, MarineTraffic.com)**



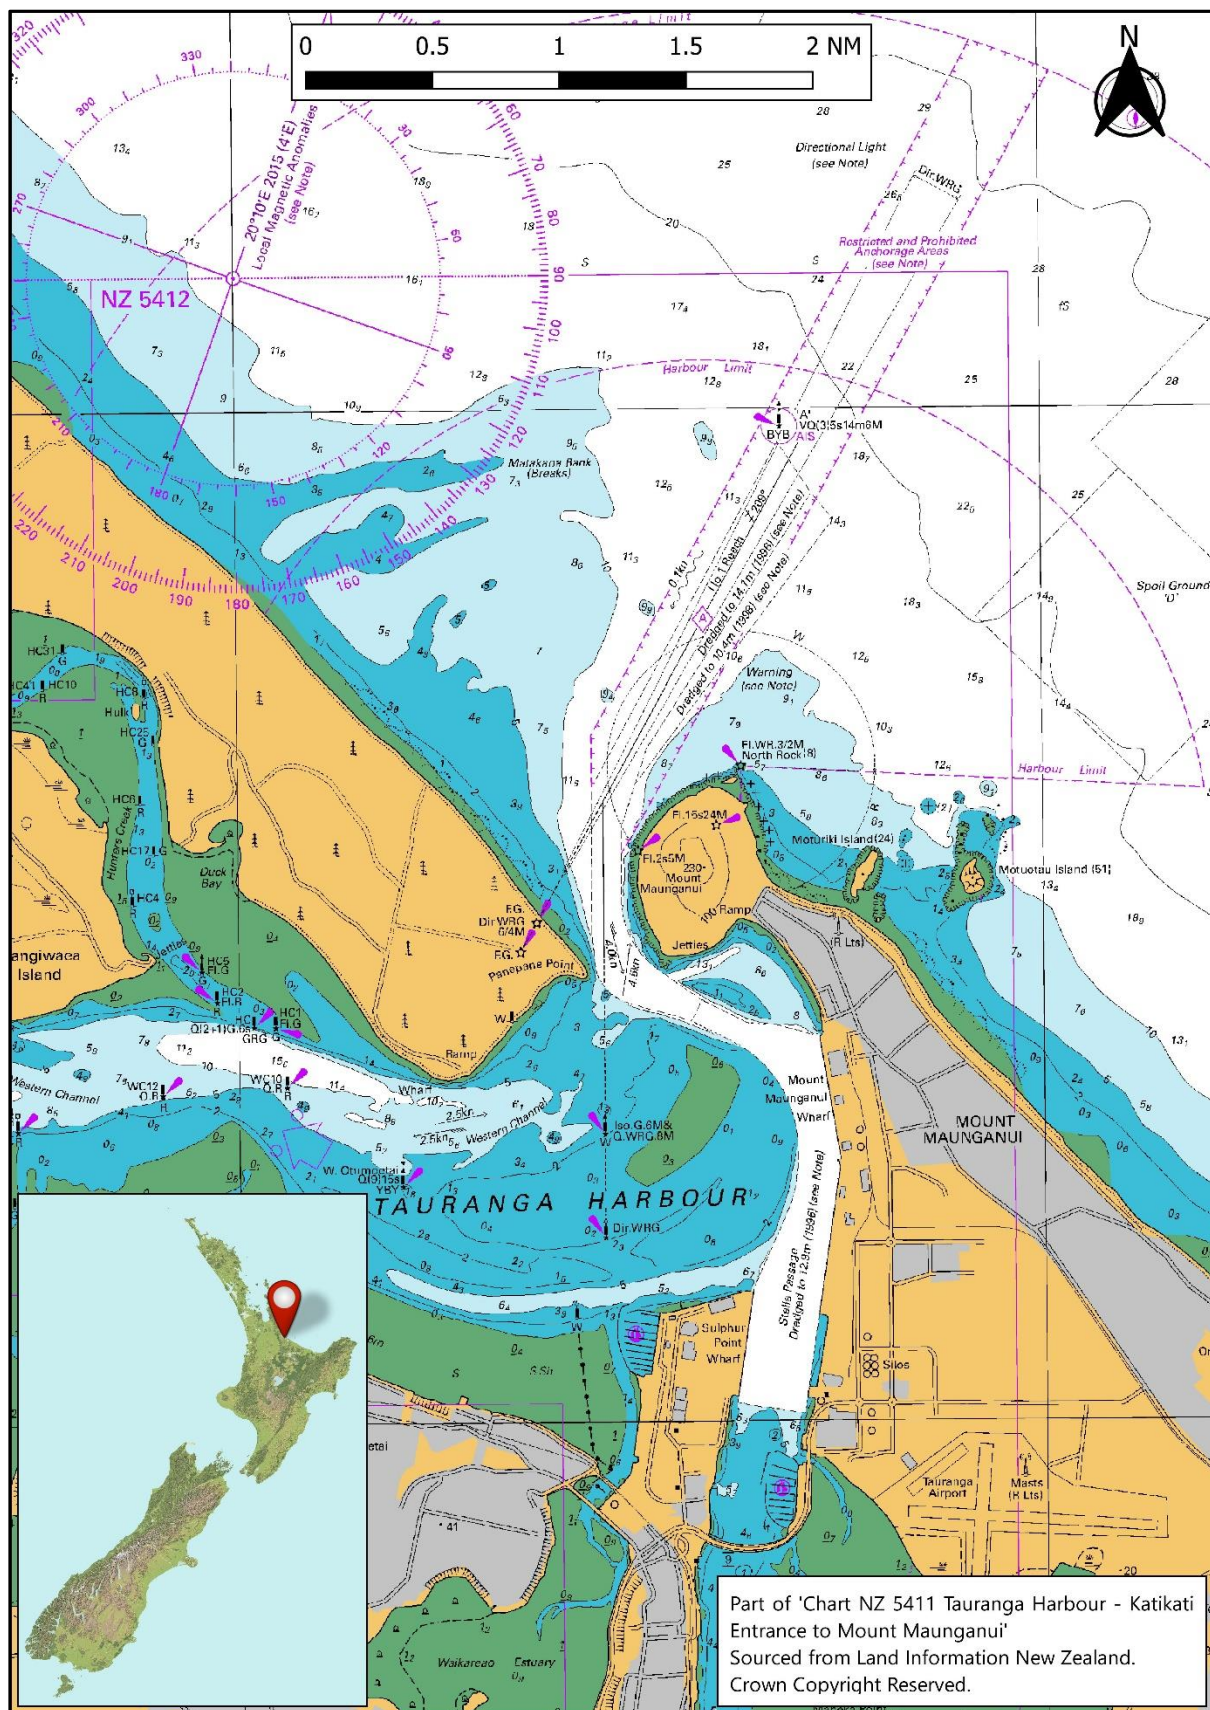

# Contents

---

<b>1</b>	<b>Executive summary.....</b>	<b>1</b>
	What happened.....	1
	Why it happened .....	1
	What we can learn.....	1
	Who may benefit .....	1
<b>2</b>	<b>Factual information .....</b>	<b>2</b>
	Narrative.....	2
	Introduction to the Funing's propulsion system .....	6
	Injection control unit.....	7
	Maintenance on the main engine ICU .....	9
	Low-sulphur fuel .....	10
	Thome Ship Management safety management system .....	10
	The engine room.....	11
	The bridge.....	11
	Roles of the master and chief engineer .....	13
	Standards of training, certification and watchkeeping.....	13
	Funing crew.....	14
	Port of Tauranga .....	14
	Testing the ICU .....	15
<b>3</b>	<b>Analysis.....</b>	<b>17</b>
	Introduction .....	17
	Vessel departed the berth with a malfunctioning main engine .....	17
	Vessel embarked on a pilotage passage in marginal environmental conditions.....	19
	Injection control unit malfunction.....	21
<b>4</b>	<b>Findings .....</b>	<b>24</b>
<b>5</b>	<b>Safety issues and remedial action .....</b>	<b>25</b>
	General.....	25
	Ineffective bridge and engine room resource management.....	25
	The defined environmental conditions for departure were marginal .....	25
	The engine manufacturer's maintenance information was not fully understood by end-users.....	25
<b>6</b>	<b>Recommendation .....</b>	<b>27</b>
<b>7</b>	<b>Key lessons .....</b>	<b>28</b>
<b>8</b>	<b>Data summary .....</b>	<b>29</b>
<b>9</b>	<b>Conduct of the inquiry .....</b>	<b>30</b>

<b>10 Report information .....</b>	<b>31</b>
Abbreviations .....	31
Glossary .....	32
<b>Appendix 1 Thome Ship Management Pte. Ltd. pilot card .....</b>	<b>33</b>
<b>Appendix 2 Port of Tauranga passage plan.....</b>	<b>34</b>
<b>Appendix 3 Summary of Wärtsilä documents providing guidance on ICU maintenance that were available to the Commission .....</b>	<b>35</b>



## Figures

---

Figure 1: The <i>Funing</i> (Credit: Owen Foley, MarineTraffic.com).....	i
Figure 2: Location of accident.....	ii
Figure 3: Excerpt from Chart NZ-5412 Port of Tauranga showing the approximate track of the <i>Funing</i> as it departed Port of Tauranga.....	5
Figure 4: Basic organisational chart of the RT-Flex fuel injection control system.....	7
Figure 5: The ICU removed from the <i>Funing</i> .....	8
Figure 6: Fuel injection control unit .....	8
Figure 7: Schematic showing the working principle of the ICU (image taken from a Wärtsilä technical bulletin).....	9
Figure 8: Bridge preparation for sea checklist.....	11
Figure 9: Excerpt from manoeuvring logbook and bell book .....	12
Figure 10: Extract from Thome Ship Management safety management system manual.....	12
Figure 11: The <i>Funing's</i> pilot card, provided to the marine pilot .....	13
Figure 12: Wind limits for Port of Tauranga.....	14
Figure 13: Port of Tauranga tidal window grades.....	15
Figure 14: Coking debris found in the cavity on the fuel oil side of the servo piston.....	16
Figure 15: Main engine RPM as the vessel departed Port of Tauranga .....	20
Figure 16: ICU leakage test results .....	22

# 1 Executive summary

---

## **What happened**

- 1.1 On 5 July 2020, the log carrier *Funing* finished loading its cargo at the Port of Tauranga and began preparations for departure. At about 2200 the officer of the watch contacted the engineers and informed them that departure was planned for midnight.
- 1.2 When the main engine was tested in the astern direction, the main engine fault log indicated there was a fuel injection quantity piston failure.
- 1.3 The engineering team attempted to rectify the fault but were unable to before the vessel departed its berth at about 0018, when the fault reoccurred again on the main engine.
- 1.4 At 0024 the tugs were let go, and at 0027 the Port of Tauranga harbour pilot ordered full ahead. The vessel's speed through the water was about 4.3 knots.
- 1.5 By 0043 the vessel's speed through the water was about 0 knots, and its speed over the ground was about the same as the ebbing tidal stream of 3.5 knots. The vessel was effectively drifting with the current and moving out of the channel.
- 1.6 Shortly afterwards the vessel drifted over channel marker 'B' buoy and the buoy's mooring chain became entangled in the *Funing's* rudder and propeller.

## **Why it happened**

- 1.7 The engineers identified a fault with the main engine during pre-departure testing, but they did not confirm it was rectified before departure.
- 1.8 Ineffective communication between the master and chief engineer meant the bridge team were not fully aware of the problem with the main engine, nor its implications in respect of vessel manoeuvrability.
- 1.9 The main engine defect was not accounted for during the bridge team's preparation for departure, and therefore the harbour pilot was also unaware of the defect.
- 1.10 The main engine fault was very likely due to the effect of low-sulphur fuel on the injection control unit.

## **What we can learn**

- 1.11 The role that bridge resource management and engine room resource management play in respect of the safety of a vessel cannot be overstated. Good communication between departments is a core principle that may, had it been implemented on this occasion, have caused the master to reconsider the planned departure time.

## **Who may benefit**

- 1.12 Vessel owners, operators, maintenance teams and crew. Port operators and marine pilots.

## 2 Factual information

---

### Narrative

- 2.1 On the afternoon of 5 July 2020, the log carrier *Funing* finished loading its cargo of logs and began preparations for departure. At about 2200 the officer of the watch (OOW) on the bridge called the engine room and gave the engineers notice of departure at midnight.
- 2.2 The second and third engineers began conducting pre-departure checks. The chief engineer arrived in the engine room at about 2215.
- 2.3 At about 2225 the duty engineer officer called the bridge and asked permission to blow through the main engine<sup>1</sup> using air.
- 2.4 At about 2228, as part of pre-departure testing, the main engine was tested in the ahead and astern directions from the engine room. When it was tested in the astern direction, the main engine fault log indicated there was a fuel injection quantity piston failure on number two cylinder.
- 2.5 Engineers removed the quantity piston cover, cleaned the piston rod and sensor with lubricant and reset the main engine slowdown alarm<sup>2</sup>.
- 2.6 At 2240 an engineer called the bridge to transfer control of the main engine to bridge control, allowing the OOW to test the engine ahead and astern of the bridge. The bridge logbook noted at 2241, "engine tested ahead and astern ok". Shortly afterwards, at the chief engineer's instruction, control of the main engine reverted to the engine room. At 2247 the main engine electronic fault log indicated an injection quantity piston failure on number two cylinder.
- 2.7 At 2300 the main engine control was transferred to the bridge so that the OOW could test the main engine both ahead and astern. The OOW informed the master of a fault with the main engine, and the master in turn spoke to the chief engineer on the telephone. Details of the fault were not discussed, but the master did ask if it would be repaired in time for departure and was reassured by the chief engineer that it would.
- 2.8 At about 2304 the engine was tested from the bridge, but the fault with the quantity piston was still present. At that time the engineers believed the problem to be the sensor on the injection quantity piston. At about 2330 the sensor was replaced, and the piston rod was lubricated.
- 2.9 The chief engineer telephoned the OOW on the bridge and advised that there was a problem with the main engine. The chief engineer asked when the harbour pilot was due to arrive on board for departure and was told midnight.
- 2.10 At about 2345 the chief engineer telephoned the master on the bridge. During the conversation the chief engineer told the master to press the 'cancel slowdown button' situated on the main engine control panel, which the master did. The cancel slowdown button cancelled the automatic engine slowdown. The master did not ask the chief

---

<sup>1</sup> Air is blown through the engine before starting it to remove any residual exhaust gas or combustion product trapped after the engine was shut down.

<sup>2</sup> Sensors attached to the engine detect certain issues and trigger a response in the engine that automatically slows the engine down to protect it from damage.

engineer why it was necessary to press the cancel slowdown button. This point is discussed further in section 3.

- 2.11 At about 2359 the engineer on watch telephoned the bridge and asked for the main engine to be placed in bridge control.
- 2.12 At about midnight the pilot arrived on the bridge and the master-pilot exchange of information took place. During the exchange the master confirmed to the pilot that there had been no immobilisation of the main engine and that the engine was free of any defects. They also discussed the passage plan for departure.
- 2.13 Forecast environmental conditions at the time of departure were:
- northerly wind 35 knots<sup>3</sup> gusting 45 knots and then easing
  - tidal stream at the entrance to the port 2.5 knots ebb<sup>4</sup>.
- 2.14 Tugs were secured at about 0006, and all mooring lines were let go and clear at about 0018.
- 2.15 As shown in Figure 3, the first main engine movement was at 0018, and the quantity piston failure alarm for number two cylinder was triggered immediately.
- 2.16 Over the next three minutes the pilot ordered dead slow ahead, slow ahead and half ahead.
- 2.17 At 0024 the tugs were let go, and at 0027 the pilot ordered full ahead and the telegraph<sup>5</sup> was set to full ahead (68 rpm [revolutions per minute]). The chief engineer noted that the main engine speed was not increasing above 48 rpm (this point is discussed further in section 3). The vessel's speed through the water was about 4.3 knots.
- 2.18 At 0028 an exhaust gas deviation alarm activated in the engine room because the number two cylinder was not firing.
- 2.19 At about 0033 the pilot asked the master why the vessel's speed was so slow, and requested more speed. In the next few minutes, the pilot repeatedly told the master the vessel was not going fast enough and asked if there was a problem. When the pilot first questioned the vessel's speed the master called the chief engineer in the engine room and told the chief engineer that they needed more speed. During the conversation the master asked the chief engineer if they could cancel the scavenge limiter<sup>6</sup>, to which the chief engineer agreed.
- 2.20 By 0043 the *Funing's* speed through the water was about 0 knots, and its speed over the ground was about the same as the ebbing tidal stream of 3.5 knots. The vessel was effectively drifting in the tidal stream and starting to move out of the channel near 'B' buoy (Figure 3). At about 0044 the pilot recalled the harbour tug *Tai Pari* to assist, and the starboard anchor was let go.

---

<sup>3</sup> One knot is equal to 1.852 kilometre per hour.

<sup>4</sup> Ebb tide is an outgoing tide.


<sup>5</sup> A telegraph is a communications device used by a bridge team to give main-engine orders to a vessel's main engine.

<sup>6</sup> 'Scavenging' is the removal of exhaust gases from an engine cylinder by blowing in fresh air. A scavenge limiter monitors the scavenge air pressure and prevents the admission of fuel into the engine. Cancelling the scavenge limiter effectively reduces the fuel/air ratio efficiency of the engine, but increases engine torque output.

- 2.21 Shortly afterwards the *Funing* drifted over the top of the channel marker 'B' buoy, and the buoy's mooring chain became entangled in the *Funing's* rudder and propeller.
- 2.22 At about 0048 the main engine automatically shut down on overload.
- 2.23 By about 0054 the *Funing* was anchored outside the main channel with its stern pointing towards shallow water.
- 2.24 By about 0054 the tug *Tai Pari* had arrived on scene and made fast with a line to the *Funing's* starboard quarter<sup>7</sup>. The tug attempted to pull the stern into the main channel, but due to the force of the wind and tide it was unsuccessful, and the tow line parted.
- 2.25 A second tug, the *Sir Robert*, had also made its way to the area. Both tugs remained on station nearby.
- 2.26 At about 0115 the engineers began to replace the injection control unit (ICU) on number two cylinder with a new unit. By 0220 the new unit was in place and tested. No alarms or faults resulted.
- 2.27 The port anchor was let go and the vessel lay to two anchors. As the tide turned the vessel pivoted around the anchors and lay aligned with the channel, with the bow pointing north-northeast.
- 2.28 The *Funing's* port quarter lay very close to 'C' buoy, so the tug *Sir Robert* was used to try to drag the stern into deeper water. Due to the environmental conditions the line parted. The pilot made the decision for the vessel to remain in position, lying to both anchors, and wait for the tide to turn.
- 2.29 At about 0800, once the tide had begun to ebb, both tugs re-secured and towed the *Funing* outside the harbour limits and re-anchored it.
- 2.30 On 14 July 2020 the *Funing* was towed back into Port of Tauranga for repairs. The hull was surveyed, and damage was found to the rudder stock and the tip of one propeller blade.
- 2.31 On 6 September 2020 the *Funing* was taken under tow to Singapore by an ocean-going tug for repair.

---

<sup>7</sup> The side of the vessel between the stern and midship, typically at the aft end.

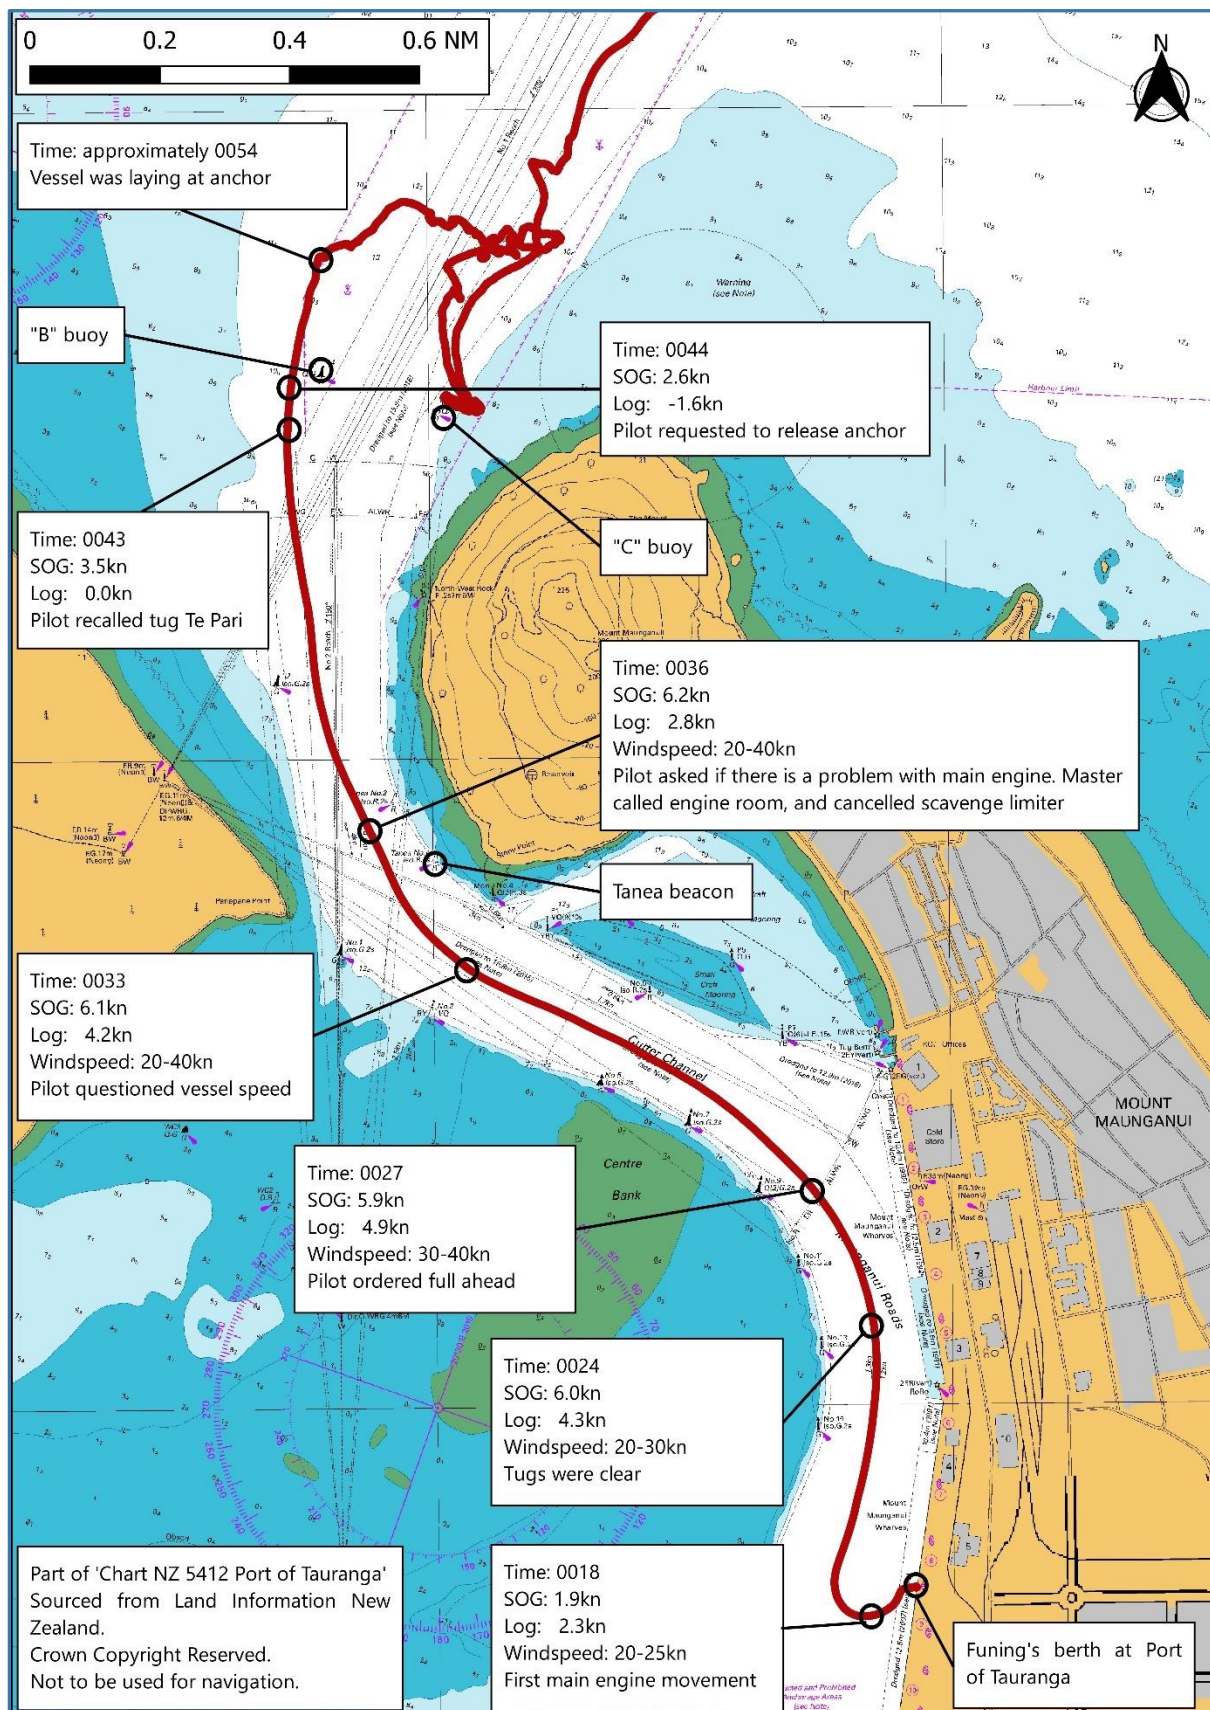

**Figure 3: Excerpt from Chart NZ-5412 Port of Tauranga showing the approximate track of the *Funing* as it departed Port of Tauranga**



## ***Introduction to the Funing's propulsion system***

- 2.32 The *Funing's* main engine was a slow-speed, five-cylinder, two-stroke diesel, Wärtsilä RT-Flex model, connected to a fixed-pitch<sup>8</sup> propeller.
- 2.33 The propulsion system did not include a gearbox, so the main engine rpm correlated to vessel speed through the water. The relationship between main engine rpm and design vessel speed is given in the Thome Ship Management pilot card (Appendix 1), and that excerpt is shown in Figure 4. Note the *Funing* was laden during its departure from Port of Tauranga.


Engine order (telegraph)	Main Engine (RPM)	Speed (knots)
Full ahead	68	10.5
Half ahead	48	7.6
Slow Ahead	40	6.4
Dead slow ahead	30	4.9
Dead slow astern	30	1.9
Slow astern	40	2.9
Half astern	48	3.7
Full astern	68	4.7

**Table 1 The relationship between Engine order, main engine rpm, and design vessel speed as provided on the Thome Ship Management pilot card for the *Funing***

- 2.34 The *Funing's* main engine was controlled by a Wärtsilä engine control system (WECS) (Figure 5), which in turn controlled an electronic Flex Control Module (FCM-20) for each cylinder. The FCM-20 controlled electro-hydraulic valves for each ICU and is discussed in more detail later in the report.
- 2.35 The function of the ICU was to supply a predetermined quantity of fuel to the engine cylinder fuel injectors. The quantity of fuel varied depended on the load on the engine, and was apportioned by a fuel injection quantity piston within the ICU. The quantity of fuel was measured by a sensor attached to the fuel injection quantity piston.

---


<sup>8</sup> When the pitch of a propeller is set at the factory where it is made, and cannot be adjusted while in use, the propeller is known as a fixed-pitch propeller.

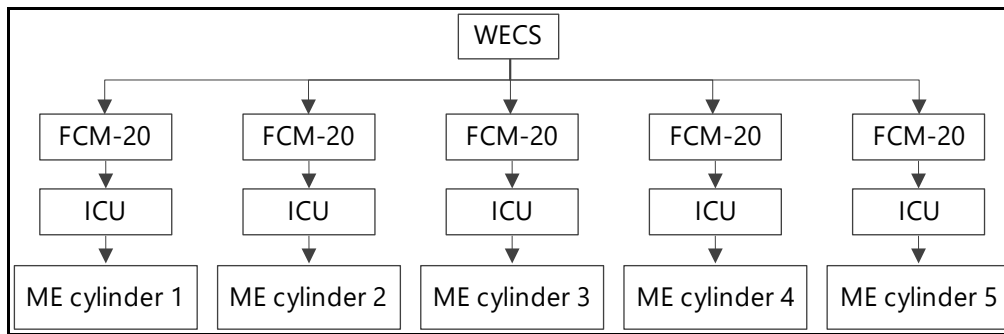


**Figure 4: Basic organisational chart of the RT-Flex fuel injection control system**

### **Injection control unit**


- 2.36 The ICU was a key component of the RT-Flex engine. Figure 5 shows a photograph of the ICU removed from the *Funing* after the accident, and Figure 6 shows a labelled image.
- 2.37 The working principle of RT-Flex engines was that fuel injection timing was controlled by a computer via electro-hydraulic valves, rather than mechanical camshafts.
- 2.38 The WECS controlled the functions of the main engine. For each combustion cycle of each cylinder, the WECS sent an 'injection command' to the FCM-20, which was relayed to the electro-hydraulic rail valves on the ICU (Figure 7).
- 2.39 When the rail valve was actuated it opened the servo oil supply to a hydraulic piston within the rail valve, which in turn caused the injection control valve to open.
- 2.40 Once the injection control valve had opened, the quantity piston started to move and fuel flowed to the fuel injector valves.
- 2.41 Injection would continue until the WECS sent, via the FCM-20, a 'return command' to the electro-hydraulic rail valve, which would close that valve.
- 2.42 When the rail valve closed the fuel injection control valve would close, ending the fuel supply to the fuel injector valves.
- 2.43 The quantity piston would then slowly return to its initial position, ready for the next injection cycle.

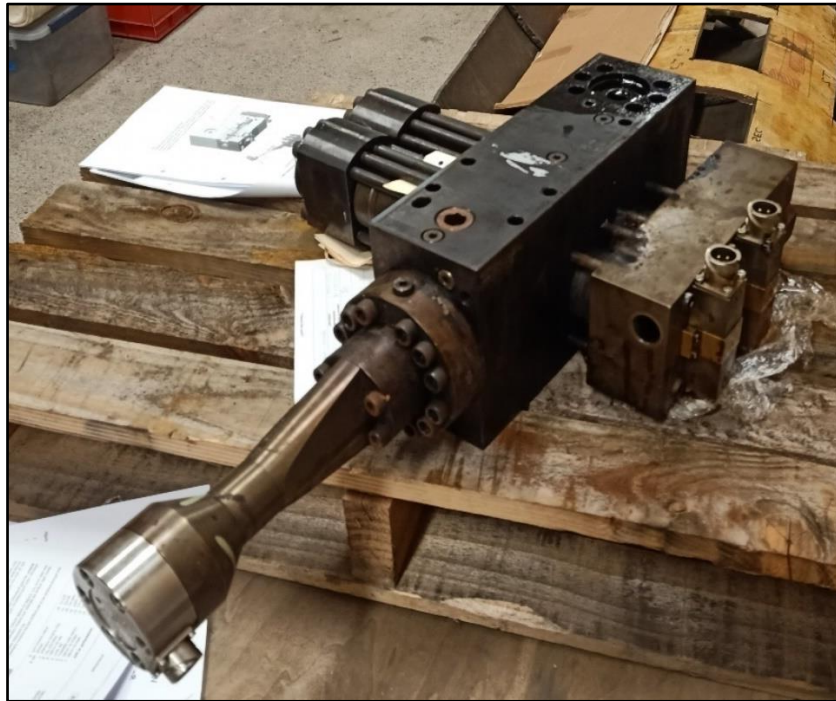

**Figure 5: The ICU removed from the *Funing***

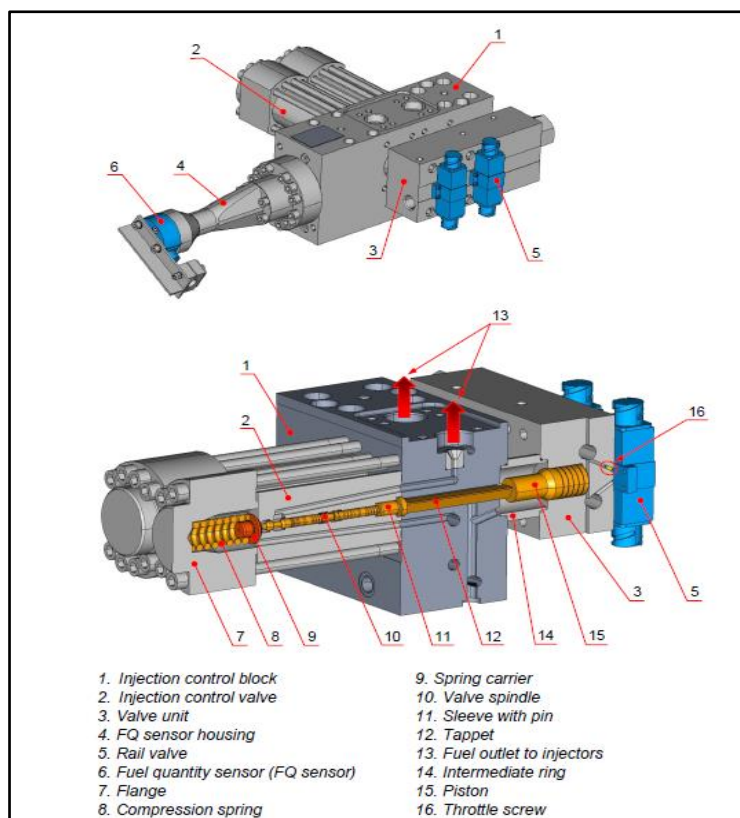

**Figure 6: Fuel injection control unit  
(Credit: Wärtsilä technical bulletin)**

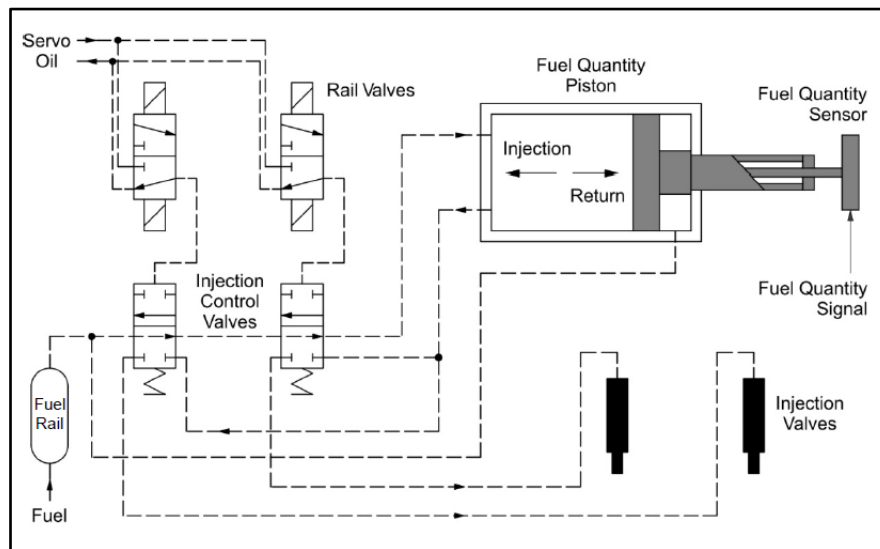

**Figure 7: Schematic showing the working principle of the ICU (image taken from a Wärtsilä technical bulletin)**

### **Maintenance on the main engine ICU**

- 2.44 Wärtsilä stated in its ICU maintenance guidance documentation: "The life expectancy of ICU components depends upon operational conditions." In the case of ICU malfunction, the options for onboard problem-solving were normally limited to replacement of the rail valves, the fuel quantity sensor and the fuel injection quantity piston. If further measures were required, the complete ICU, including rail valves and fuel quantity sensor/piston, should be sent for repair or renewal.
- 2.45 Wärtsilä technical bulletins advised that the onboard maintenance of ICUs was limited to trouble shooting and "simple rectifying actions". They stated that ICUs should be returned to a Wärtsilä service centre for remanufacture after they had reached their life-time service hours, which Wärtsilä estimated at 36,000 hours of service. The data and specification for overhauls of engine components are shown in Appendix 3. They recommend the ICU lifetime service hours, checking a filter and checking the engine monitoring software for incorrect rail valve timing. Incorrect rail valve timing could indicate excessive leakage.
- 2.46 The defective ICU removed from the *Funing* had accumulated 24,586.6 hours of service.
- 2.47 One of the onboard maintenance tasks was to monitor any 'leakage' within the ICU. Leakage is a normal operating feature of an ICU.
- 2.48 When mechanical components, such as a hydraulic piston or cylinder liner, slide against each other they are subject to wear. As the two components wear, the clearance between them increases. At some stage the clearance will be large enough for oil to leak between the components. Fuel quality can have a significant effect on engine wear, and can vary depending on where it is sourced.
- 2.49 The viscosity of the fuel oil can also lead to leakage. Low-viscosity fuel can leak between components where high viscosity fuel would not.

- 2.50 The leakage can result in fuel oil being present where it should not be. In the case of fuel leakage in an ICU, where the temperature is high enough, a coking<sup>9</sup> process may occur and create coking deposits within the ICU.
- 2.51 Recent maintenance of the ICUs had included measuring leakage each month. The most recent testing had been conducted on 11 May 2020, approximate two months before the accident. The test result had not indicated an issue with leakage. Records showed no test was conducted in June, hence it was one month overdue.
- 2.52 Leaked oil can drain from the ICU and is collected in a drain tank; the drain tank is monitored daily. Changes in the rate of oil leakage to the drainage tank may indicate a problem with an ICU.

### **Low-sulphur fuel**

- 2.53 As part of reducing harmful emissions from shipping, the International Maritime Organization (IMO) had introduced a limit on sulphur in marine fuels; this had come into force in January 2020. Compliant fuel was referred to as 'low-sulphur fuel'. The *Funing* was using low-sulphur fuel.
- 2.54 Wärtsilä had provided guidance on "operating 2-stroke engines in compliance with the global sulphur cap 2020" as a business white paper in 2019.
- 2.55 The paper had advised that: "continuous operation of the engine using high sulphur HFO (heavy fuel oil) would result in the standard lifetime service hours being achieved. When switching to clean low-sulphur fuels with low viscosity the efficiency or function of the engine's fuel injection components might be affected".
- 2.56 Wärtsilä also noted in its technical journal, In Detail (issue 02 2019), that leakage and the premature wear and tear of components were the biggest concerns when switching to low-sulphur fuel.
- 2.57 Wärtsilä provided a technical bulletin, RT-229, titled Operation Guidance to the Sulphur Cap 2020, which targeted all owners and operators of Wärtsilä two-stroke engines.
- 2.58 Section 3.1 of RT-229 discussed the implications of low-sulphur fuels for ICUs. The implications were outlined under two categories: small and medium bore engines, and big bore engines.
- 2.59 With respect to small and medium bore engines, such as that fitted to the *Funing*, RT-229 stated, "Leakage rates from individual ICUs should be measured together with fuel viscosity information to record a trend of the leakage development. As general guidance, leakage rates... on respective ICUs during [low-sulphur fuel] use are an indication for worn ICUs."

### **Thome Ship Management safety management system**

- 2.60 The IMO's International Safety Management Code requires vessels to maintain a safety management system that:

---

<sup>9</sup> A process where oil heated to high temperatures in the absence of oxygen releases all the volatile components. A hard and strong high-carbon material named coke is left behind.

- is managed and enforced by the master
- ensures the maintenance of the ship in safe condition
- ensures compliance with the relevant rules and regulations.

2.61 The *Funing* was managed by Thome Ship Management Pte. Ltd. (Thome Ship Management). The vessel's safety management system was contained within a safety management system manual. In respect of this accident the relevant sections of the *Funing's* safety management system manual are outlined below.

### The engine room

2.62 The OOW provided the engineers with two hours' notice for preparing and testing the main engine and auxiliary systems in accordance with their safety management system checklist. Under normal circumstances, two hours provided adequate time to work through the checklist and test the main engine ahead and astern from both the engine room and the bridge.

### The bridge

2.63 The bridge team were required to complete, and sign, a hard-copy checklist that covered bridge preparation for sea. One of the checklist items (shown in Figure 9) was to confirm with the engineers that the main engine had been tested both ahead and astern. When the checklist was completed it was countersigned by the master. On the day of the accident the checkbox confirming that the main engine had been tested was ticked.

8	Has the main engine been tested? (Ahead/astern movements) (Master must clearly specify when ME is to be tried out. E.g. After Pilot on board, loading arms disconnected, gangway, ramps, derricks, crane housed, tug fast, etc)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
---	--	-------------------------------------	--------------------------	--------------------------

**Figure 8: Bridge preparation for sea checklist**

2.64 The bridge manoeuvring logbook and bell book<sup>10</sup> was a single logbook that was used to record vital information about the vessel's movements. As shown in Figure 10, the manoeuvring logbook and bell book recorded that the main engine had been tested ahead and astern at 2240. The bridge logbook recorded the same.

<sup>10</sup> A manoeuvring logbook and bell book is a document that records information significant to a vessel's movements and the main engine.



ARRIVAL Port TAKANIGA, OZULX Date 2003L  
 DEPARTURE Port XIZ Date 2003L Voy No. 2003L  
 Tested telegraph at 2240 Steering engines at 2240 Clocks at 2200 hrs.  
 STAND BY at 2240 hrs. C.O.P. at 2240 hrs.  
 E.O.P. at 2240 hrs. F.W.E. at 2240 hrs.

MOVEMENT	TIME
1 HD NOTICE TO E/R	2200
ALL NAV EQPTS. WORKING	
INTERNAL COMM.	
TESTED 2 SPEEDING	
PUMP WORKING. OK.	
M.E. TESTED AHEAD	2240
AND ASTERN.	

**Figure 9: Excerpt from manoeuvring logbook and bell book**

- 2.65 When a pilot boards a vessel, a formal meeting takes place between the master and the pilot, known as the master-pilot exchange of information (Appendix 1). The purpose of the meeting is to ensure that the pilot and the bridge team have, among other things, a shared mental model of the intended passage plan, the vessel manoeuvring characteristics and any operational defects.
- 2.66 The *Funing's* safety management system manual included a section regarding the master-pilot exchange (shown in Figure 11) that, in part, required the master to discuss "unusual characteristics, or malfunctioning equipment".

**9.4 Master – Pilot data exchange**

Following review of local navigational and weather conditions,  
 Master will discuss following with the Pilot promptly upon boarding:

- Manoeuvring characteristics
- Light/ loaded condition,
- Unusual characteristics or malfunctioning equipment.
- local conditions and

Page 14 of 17 TGM 2.3.4 Safe Navigation Rev 3 of 2019-09-17

**Figure 10: Extract from Thome Ship Management safety management system manual**

- 2.67 A pilot card (Appendix 1) was completed by the master to provide the pilot with critical information in an easily accessible format upon their boarding the ship. It included whether the main engine had been tested ahead and astern (excerpt shown in Figure 12). Although the checkbox had been circled ambiguously, it was likely that it showed the main engine had been tested as already noted in the bridge logbook, manoeuvring logbook and bell book.
- 2.68 The pilot stated at interview that they had not been made aware of any defects or issues with the main engine prior to sailing.

Bridge control / ER control	Engine telegraphs operational	Yes / No	Engines tested Ahead/Astern	Yes / No
-----------------------------	-------------------------------	----------	-----------------------------	----------

**Figure 11: The *Funing*'s pilot card, provided to the marine pilot**

### Roles of the master and chief engineer

- 2.69 The *Funing*'s safety management system manual included sections defining the responsibilities of each of the vessel's crew.
- 2.70 The master of the *Funing* was responsible for, in part:
- the safety of life, ship and cargo
  - ascertaining seaworthiness of the vessel in all respects (stores, navigation equipment, machinery etc) prior to sailing.
- 2.71 The chief engineer of the *Funing* was responsible for, in part:
- the maintenance and operation of all machinery on board
  - the safe running, management and maintenance of all engine and machinery related items
  - keeping the master informed of all matters related to the vessel's machinery and electrical installations.

### Standards of training, certification and watchkeeping

- 2.72 The IMO adopted the International Convention on Standards of Training, Certification and Watchkeeping for Seafarers (the STCW Convention) in 1978, and the most recent major revision came into force in 2010. In 1995 the Seafarers' Training, Certification and Watchkeeping Code (STCW Code) was adopted and gave effect to the STCW Convention.
- 2.73 Part A of the STCW Code – Mandatory Standards, Chapter II (Standards regarding the master and deck department) and Chapter III (Standards regarding the engine department), required that officers in charge of a watch "demonstrate the competence to undertake, at the operational level, the tasks, duties and responsibilities listed", which included:
- maintain a safe watch using the principles and methods of BRM (bridge resource management) or ERM (engine room resource management).
- 2.74 One principle of BRM and ERM was 'effective communication'. The criteria for effective communication were listed as:
- communication is clearly and unambiguously given and received
- For example, when the control of the main engine is transferred to the bridge prior to departure, the chief engineer must clearly state whether the main engine is ready for manoeuvring, or describe any issues that might limit the ability to manoeuvre the vessel safely

- questionable decisions and/or actions result in appropriate challenge and response

For example, if a master were made aware of a potential issue with the main engine prior to departure, and the chief engineer requested the master to activate a button that cancelled the main engine's automatic slowdown, the master should challenge that request.

## ***Funing crew***

- 2.75 The master held a master mariner certificate of competency issued in 2008. The accident voyage was part of their second tour of duty as master on board the *Funing*.
- 2.76 The chief engineer had been promoted to the position of chief engineer in 2011. This tour of duty was the first time they had sailed on board the *Funing*.
- 2.77 At the time of the accident the master and the chief engineer had been on board the *Funing* for about 10 months and six months respectively.

## ***Port of Tauranga***

- 2.78 Port of Tauranga provides a pilotage service to vessels over 250 gross registered tons unless the master holds a pilot exemption certificate; the *Funing* was over 250 gross registered tons and required a pilot.
- 2.79 The Port of Tauranga safety management system manual provided pilots with standard operating procedures to support their operations and ensure safe pilotage. The safety management system included the environmental conditions suitable for conducting pilotage operations.
- 2.80 The standard operating procedures prescribed an upper wind limit for pilotage based on the type of vessel involved (Figure 13). The prescribed upper wind limit for the *Funing*, a fully laden, deep-draught bulk carrier, was 40 knots.
- 2.81 Further, the wind limit could be extended or restricted by the pilot, in which case the master should be fully informed on and agree to the intended movement.
- 2.82 Pilots were also to consider the impacts of sea and swell conditions on vessels' speeds.

2.1.2 Wind Limits		
All vessels		40 knots
Container vessels		30 knots
High sided vessels	Passenger, Ro-Ro, Car Carrier and Light draft bulk carriers or tankers	25 Knots

Wind speed is an average measure over a 15 minute period as displayed on the EnView site.

It may be appropriate to reduce wind limits at times due to available tug power. Any reduction is at the sole discretion of the Pilot conducting the pilotage.

**Figure 12: Wind limits for Port of Tauranga**

- 2.83 The tidal stream can significantly affect the manoeuvring characteristics of large vessels. The standard operating procedures prescribed upper limits for the rate of tidal stream by using the vessel's length and draught as key factors.

2.84 The length of the *Funing* was greater than 160 metres and it had a draught greater than 9.5 metres and less than 12.5 metres. The corresponding prescribed upper limit for the rate of tide was less than or equal to 2.5 knots (see Figure 14).

	LOA (metres)	DRAFT (metres)	IN (Grade)	OUT (Grade)
Tankers & Bulk Carriers	all	> 12.5	A	A
	> 160	> 9.5	A	C
		< 9.5	B	C
		< 7.5	C	C
	126 – 160	> 7.5	B	C
		< 7.5	C	C
	< 125	> 7.5	C	D
		< 7.5	E	E

Grades are as follows;

A <= 1.5 kts

B <= 2.0 kts

C <= 2.5 kts

D <= 3.0 kts

E = Non tidal

**Figure 13: Port of Tauranga tidal window grades**

2.85 The Port of Tauranga provided a comprehensive passage plan for the port. Included as part of the plan were:

- a check of whether there were any deficiencies that might influence the passage plan
- a check of whether any main engine maintenance had been carried out while in the Port of Tauranga
- the environmental conditions expected for the pilotage passage.

2.86 Appendix 2 shows the Port of Tauranga passage plan completed for the departure of the *Funing* on the day of the accident. The pilot was expecting a wind of 35 knots gusting to 40 knots, and an ebb tide of 2.5 knots.

## Testing the ICU

2.87 During pre-departure checks of the main engine, a fault was identified on the injection quantity piston for number two engine cylinder, which had failed. It is very likely that the injection control valve was unable to move because it had become seized with coking debris that had entered the system and interfered with the operation of the valves.

2.88 The same failure occurred again while the vessel was departing Tauranga.


2.89 After the accident, when the vessel was laying at anchor, engineers replaced the ICU with a new unit. Replacing the ICU resolved the fault.

2.90 The malfunctioning ICU was secured by the Transport Accident Investigation Commission (Commission), which then subjected it to forensic examination to determine the cause of failure.

2.91 The Commission engaged two independent experts to conduct the forensic examinations of the ICU: Quest Integrity Ltd, which had expertise in metallurgy and

forensic examination; and Det Norske Veritas, which had expertise in the Wärtsilä RT-Flex engine.

- 2.92 The examination of the ICU was conducted at the Quest Integrity laboratory in Wellington, New Zealand. The draft report and its findings were discussed with a technical representative from Wärtsilä.
- 2.93 The examination found that in the ICU the rail valves<sup>11</sup> were operational, and one of the two injection control valves had seized, very likely due to coking debris entering the system. Figure 15 shows the coking debris found in the cavity on the fuel oil side of the servo piston<sup>12</sup>.

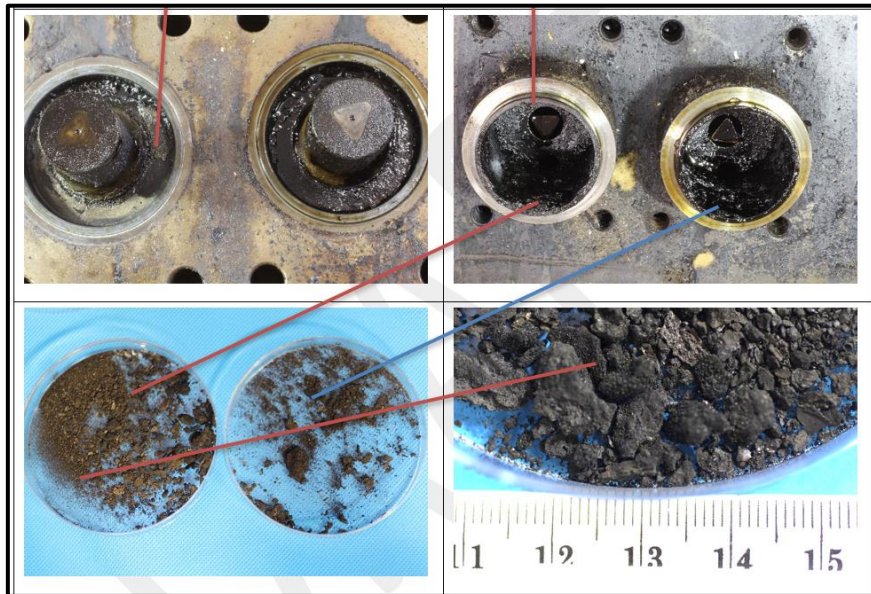

**Figure 14: Coking debris found in the cavity on the fuel oil side of the servo piston**

<sup>11</sup> See Figure 7, Item 5.

<sup>12</sup> See Figure 7, Item 15 labelled on the cross-sectional view of the ICU.

## 3 Analysis

---

### Introduction

- 3.1 The *Funing* was a bulk carrier that could not generate enough propulsive power to overcome the prevailing adverse environmental conditions while under pilotage. As a result, the vessel lost control, deviated from the channel and became entangled in a channel marker buoy.
- 3.2 It is virtually certain that the *Funing*'s main engine was unable to generate full power because a fuel ICU for number two engine cylinder was malfunctioning, and the cylinder was not firing.
- 3.3 The environmental conditions were at the upper end of the allowable limits, which meant optimal engine power was required for the vessel to navigate the channel safely.
- 3.4 Three safety issues were identified:
  - ineffective communication between the master and chief engineer meant the master was not fully aware of the malfunctioning main engine prior to the vessel departing its berth
  - the vessel's main engine malfunction, combined with the prevailing environmental conditions, exceeded the safety considerations in the pilotage plan, and the vessel's navigational control was rendered ineffective
  - the introduction of low-sulphur fuel has had a significant effect on the performance of marine diesel engines. Although Wärtsilä had provided, in various documents, guidance on the effects of using low-sulphur fuels in its ICUs, this had not been fully integrated into the vessel's safety management and planned maintenance systems.

### Vessel departed the berth with a malfunctioning main engine

**Safety issue: Ineffective communication between the master and chief engineer meant the master was not fully aware of the malfunctioning main engine prior to the vessel departing its berth.**

- 3.5 The chief engineer's role on board the *Funing* included responsibility for the "maintenance and operation of all machinery on board". In practice the chief engineer was responsible for managing all aspects of the engine room, and in particular ensuring that the main engine was fully operational before handing over control to the bridge.
- 3.6 The bridge team had notified the engine room approximately two hours before the intended departure time, which was sufficient for them to complete all their pre-departure preparations and testing.
- 3.7 About 28 minutes after commencing their preparations, the engineers tested the main engine ahead and astern and became aware of a malfunction with the ICU on the number two cylinder.
- 3.8 They followed the trouble-shooting guidance provided by the engine manufacturer and attempted to rectify the problem four times. Each time the ICU on number two cylinder failed.



- 3.9 The fourth test failed at 2342, which was 18 minutes before the planned departure. The engine room team had tried to rectify the fault using the information they had available to them on board the vessel. Although the chief engineer had already tried rebooting the number two cylinder control module and resetting the alarms, it was decided to try one more time.
- 3.10 However, the engine was not tested again to confirm that it was functioning properly. The most recent test had shown that the main engine was malfunctioning.
- 3.11 Given the safety management system requirement for the chief engineer to keep “the master informed of all matters related to the vessel’s machinery”<sup>13</sup>, this was probably the last opportunity before departure to discuss the issue with the master.
- 3.12 A few minutes later, at 2345, the chief engineer called the master on the bridge. During what was a brief conversation, the chief engineer told the master to cancel the automatic slowdown, but did not explain the reason for or the implications of doing so, specifically a likely reduction in propulsive power.
- 3.13 The automatic slowdown feature of the main engine was designed to protect it from damage if it malfunctioned. If there were a risk of the main engine malfunctioning during a safety-critical passage or manoeuvre, the feature could be cancelled.
- 3.14 It was rare to cancel the automatic slowdown, and the master had never used the feature previously. The request to cancel it was an indication that the chief engineer believed the main engine might malfunction. That the master had never used the function before was an opportunity to question the chief engineer’s request. By ascertaining the reason for cancelling the automatic slowdown the master may have discovered that the main engine was malfunctioning and the potential effects on the vessel’s manoeuvrability.
- 3.15 However, the master complied with the chief engineer’s instruction to cancel the automatic slowdown without discussing the reason or the implications.
- 3.16 As a result, the bridge team were unaware of the defect with the main engine and its implications, and consequently were unable to brief the pilot accordingly.
- 3.17 The Commission identified two likely reasons for the bridge team being unaware of the main engine malfunction:
- the OOW observed the main engine turning ahead and astern during the pre-departure test
  - the main engine defect and its implications were not clearly communicated between the engine room and bridge teams.

#### **Crew resource management**

- 3.18 The key principle of BRM and ERM is that they use all available resources, including people, procedures and equipment, to provide safeguards against accidents created by human performance. The master and chief engineer had both been trained in BRM and ERM respectively.
- 3.19 Although the bridge team demonstrated an effective use of closed-loop communication with respect to helm and engine orders during pilotage, there was a lack of departmental communication between the engine room and the bridge –

---

<sup>13</sup> Funing’s safety management system manual

specifically that the master and chief engineer did not maintain a clear and unambiguous line of communication. The requirements and benefits of good departmental communication had not been addressed in the safety management system.

- 3.20 Had the master been made aware of the engine defect and its implications, the pilot could have been briefed accordingly. As a result both master and pilot would have been better able to make informed decisions on whether it was safe to depart as planned. The reality was that the master, unaware of the defect, believed his vessel would perform as designed in what were marginal environmental conditions.
- 3.21 The Commission would have recommended to Thome Ship Management that it review the safety management system used on board the *Funing* to ensure that it incorporated the requirement for crews to communicate safety-critical information.
- 3.22 However, as a result of the accident Thome Ship Management has already implemented changes to the safety management system to ensure that the master and chief engineer maintained full and clear communication. As a result, no recommendation had been made.

### ***Vessel embarked on a pilotage passage in marginal environmental conditions***


***Safety issue: The vessel's main engine malfunction, combined with the prevailing environmental conditions, exceeded the safety considerations in the pilotage plan, and the vessel's navigational control was rendered ineffective.***

- 3.23 The manoeuvring characteristics of a vessel, and hence the control of the vessel are, in part, dependent on the rate of water flow past the rudder.
- 3.24 The speed of the vessel is dependent on the main engine producing enough power to overcome the drag<sup>14</sup> of the vessel. The drag of a vessel is a combination of the characteristics of the hull in the water and the environmental conditions acting on the entire vessel, for example wind acting on the superstructure. An increase in wind speed and wave action will increase the drag of a vessel.
- 3.25 The main engine was connected directly to the propeller, which in turn produced the water flow past the rudder. The relatively low power output produced by the main engine meant the propeller shaft revolutions could only increase as the vessel accelerated through the water. When the environmental conditions were adverse, it would take longer for the vessel to accelerate, and therefore the manoeuvring characteristics during this period would be reduced.
- 3.26 Figure 16 shows the main engine rpm and vessel speed as the *Funing* departed Port of Tauranga. The X-axis shows the time. The left-hand Y-axis shows the engine rpm commanded by the telegraph, and the engine rpm as measured on the engine itself. The right-hand Y-axis shows the *Funing's* speed through the water.
- 3.27 It can be seen in Figure 16 that the telegraph showed the sequential bridge team commands from dead slow ahead to full ahead, but the actual rpm never consistently reached half ahead (48 rpm).

---

<sup>14</sup> A mechanical force that results from the interaction of a solid body with a fluid. Drag acts in opposition to the direction of the propelling force.

- 3.28 Due to the reduced power of the malfunctioning main engine, the increased drag due to vessel speed and the adverse environmental conditions, the *Funing* did not consistently reach half ahead rpm when commanded by the telegraph.
- 3.29 When the *Funing* rounded Tanea beacon it was more exposed to the head sea and wind. The combination of reduced main engine power and adverse environmental conditions further reduced the vessel's rate of acceleration and its ability to increase speed. As a result, its manoeuvring characteristics were significantly diminished and ultimately overcome by the increasing environmental effect, and the vessel's speed through the water was reduced to near zero knots.

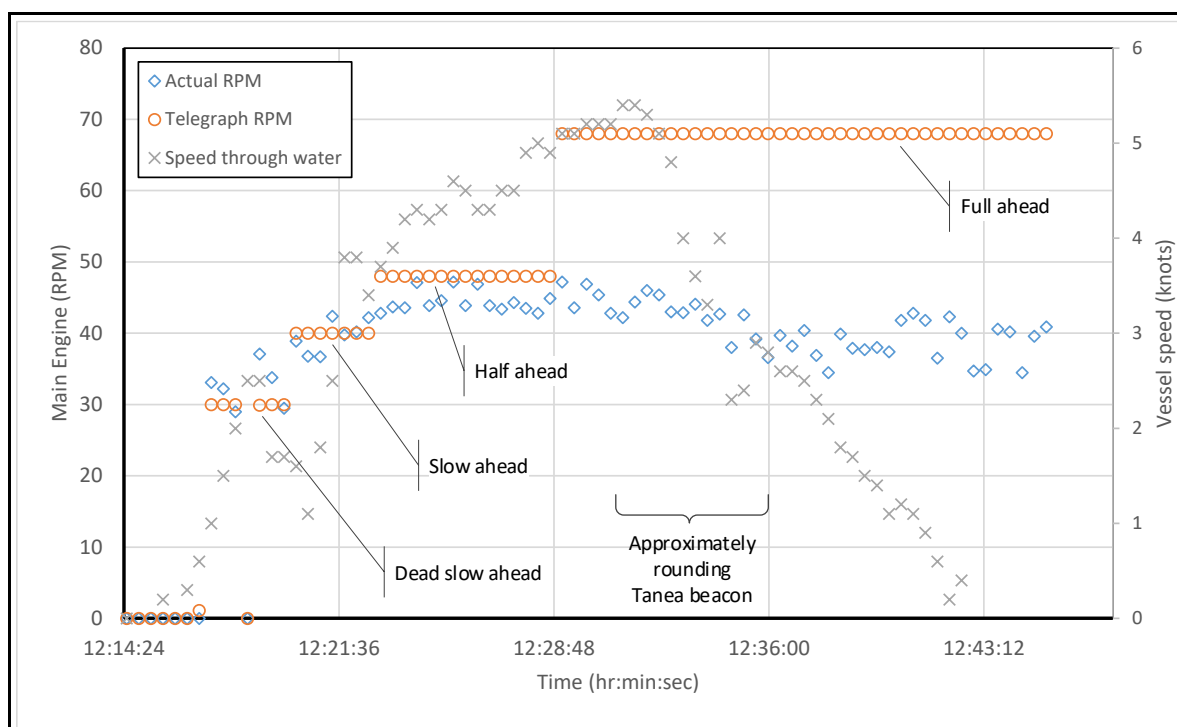

**Figure 15: Main engine RPM as the vessel departed Port of Tauranga**

#### **Port of Tauranga safe operating procedures**

- 3.30 Port of Tauranga's safe operating procedures (SOPs) included both preventive risk mitigation and recovery risk mitigation with respect to the pilotage service it offered.
- 3.31 Preventive risk mitigation for safe pilotage included, but was not limited to, identifying risks to navigation and the vessel size- and type-specific upper limits for environmental conditions such as wind, tidal currents, wave and swell.
- 3.32 Recovery risk mitigation included, but was not limited to, the use of tugs for vessels' loss of power, and taking account of environmental conditions.

#### **Port pilotage passage plan environmental conditions**

- 3.33 The environmental conditions at the time of the *Funing*'s departure, and described in the pilotage passage plan, were at the upper end of the allowable environmental limits described in Port of Tauranga's safety management plan.
- 3.34 Had the *Funing*'s main engine been able to produce full power, it is very likely the vessel would have completed the outbound pilotage without issue.

- 3.35 In this case the unexpected lack of propulsive power due to the main engine malfunction had not been relayed to the pilot prior to departure.
- 3.36 Although the risk mitigations in place did not seem unreasonable, the Commission would have made a recommendation to Port of Tauranga that it assess the allowable weather windows for pilotage and the ability of its tugs to mitigate the risk of a vessel losing power while under pilotage. However, it has already instituted changes to its SOPs that address both issues.
- 3.37 The changes are:
- a reduction in upper wind limits for all vessels, from 40 knots to 30 knots
  - a new SOP that mitigates the risk of high swell in the port's outer channels
  - the provision of vessel-type risk profiles regarding propulsion failure and the requirement for regular tug escorts for outgoing vessels.

## ***Injection control unit malfunction***

***Safety issue: The introduction of low-sulphur fuel has had a significant effect on the performance of marine diesel engines. Although Wärtsilä had provided guidance, in various documents, on the effects of using low-sulphur fuels in its ICUs, this has not always been fully understood by end-users.***

- 3.38 The vessel was unable to increase speed because the power produced by the main engine was unable to overcome the vessel's drag induced by environmental conditions.
- 3.39 The primary reason for the vessel being unable to develop sufficient propulsive power was that number two cylinder of the main engine was not firing as a result of a malfunction of number two cylinder's injection control unit. It is possible that other factors, such as hull fouling, propeller fouling<sup>15</sup> and changes in the normal operating conditions of the vessel, further contributed to the main engine's inability to generate sufficient propulsive power to manoeuvre the vessel safely.
- 3.40 The malfunction of the ICU occurred prior to the vessel leaving the safety of its berth.
- 3.41 Number two cylinder was malfunctioning because an injection control valve within the ICU was unable to move. This meant that the quantity piston was also unable to move properly, resulting in fuel not being properly injected into the cylinder, and the cylinder not firing.
- 3.42 It is very likely that the injection control valve was unable to move because it had become seized with coking debris that had entered the system and interfered with the operation of the valves.
- 3.43 As discussed in sections 2 and 3 of this report, the coking deposits within the ICU occurred because of fuel leakage. The leakage was likely a result of two things associated with low-sulphur fuels:
- increased wear of the ICU components
  - low-viscosity fuel.

---

<sup>15</sup> Hull/Propeller fouling can cause an engine to reach its maximum continuous rating before it reaches full RPMs. This condition is called heavy running of the fixed pitch propeller.

- 3.44 There was evidence to indicate the engineers had been monitoring the condition of the ICU; for example, they had conducted monthly leakage measurements of each ICU. The magnitude of the leakage for number two ICU was recorded as between 1.74 and 2.07 litres per hour in a five-month period, as shown in Figure 17. These recorded leakage values can be considered minimal, representing values unlikely to lead to coking.

MV:Funing									
Main engine ICU leakage									
[Very low sulphur fuel (litres)]									
Date	[Main engine running hours]	Period	unit 1	unit 2	unit 3	unit 4	unit 5	Total	
4-Jan-20	22459	1hr	0.72	1.74	1.15	3.07	3.42	10.1	
FEB								0	
21-Mar-20	23353	30 min						0	
8-Apr-20	23493	1 Hr	0.46	2.68	1.9	2.87	2.72	10.6	
11-May-20	23669	1 Hr	0.63	2.07	1.68	4.32	4.26	13	
11-Jun-20	24135	1 Hr						0	

**Figure 16: ICU leakage test results**

- 3.45 As general guidance, Wärtsilä states that leakage rates of above 12 litres per hour while using low-sulphur fuel are an indication that the ICU is worn. When the Commission inspected the ICU, coking debris was found, which indicated excessive leakage. However, it is not clear why there was a disparity between the daily and monthly leakage measurements recorded on board and the coking found in the ICU.
- 3.46 The ICU was a critical component of the vessel's main engine, and its malfunction directly affected the safety of the vessel. Wärtsilä provided preventive risk-mitigation methods and recovery risk-mitigation methods. Preventive risk mitigation was provided by preventive maintenance, and recovery risk mitigation was provided by malfunction alarms and troubleshooting guidance.
- 3.47 The engineers knew of the malfunction after being alerted by the various alarms and fault codes provided by the main engine monitoring system. They exhausted their understanding of the ICU troubleshooting guidance but were still unable to rectify the malfunctioning ICU.

#### **Preventive maintenance**

- 3.48 Planned maintenance programmes are intended to rectify defects before they arise. By design, the onboard planned maintenance programme for the ICU was limited to basic lubrication and cleaning and monitoring certain performance metrics, in this case fuel leakage within the ICU.
- 3.49 Wärtsilä required the ICU to be remanufactured at its service centre when the ICU had reached its lifetime running hours. The inspection and overhaul specification provided by Wärtsilä estimated the lifetime of the ICU at 36,000 service hours.
- 3.50 Because the ICU had been designed to run effectively without significant onboard maintenance, the engineers relied on the estimated lifetime service hours and monitoring performance metrics to ensure the full function of the ICU.
- 3.51 Although the ICU service lifetime was estimated at 36,000 hours, the ICU on number two cylinder had accumulated less than 25,000 hours before it malfunctioned.

### *Low-sulphur fuel*

- 3.52 The IMO had introduced a low-sulphur fuel cap in January 2020 for reasons of environmental protection. The change in fuel types and profile meant significant uncertainty for the maritime industry around the performance of ships' engines.
- 3.53 Wärtsilä had provided various documents, information and optional upgrades to end-users of its engines regarding the effects of low-sulphur fuel on Wärtsilä engines.
- 3.54 In Wärtsilä's business white paper of 2019 it stated that using high-sulphur fuels would result in engine components achieving estimated lifetime service hours, but that the efficiency or function of the engines' fuel-injection components might be affected by using low-sulphur fuel. It also noted in its technical journal that, "Leakage and premature wear and tear on components are the biggest concerns when switching to low-sulphur fuel."
- 3.55 In this case the ICU malfunctioned far short of its estimated lifetime service hours, and this was very likely due to coking caused by oil leakage.
- 3.56 During a meeting with the engine manufacturer and another meeting with ship managers to discuss the ICU malfunction, the Commission noted that Wärtsilä had produced a number of guidance notes on the subject of ICU performance and maintenance. However, on the vessel there was no single, comprehensive document available to the vessel's engineers to address the effects of low-sulphur fuel on ICU maintenance. The guidance that had been provided by Wärtsilä to the vessel manager had not been fully integrated with the vessel's safety management and planned maintenance systems.
- 3.57 The switch to low-sulphur fuels across the marine industry brought significant uncertainty on how the new fuels would affect engine performance, maintenance and longevity. Wärtsilä has provided guidance on monitoring fuel leakage, analysing engine monitoring software, the potential effects of using low-sulphur fuels, and upgrading ICU parts. However, the information is located in various documents and is not always available to, or fully understood by, end-users. See Appendix 3 for a list of those documents.
- 3.58 The Commission has made a recommendation to Wärtsilä that it take further steps to ensure that users of its RT-Flex engines can easily locate and assimilate all information regarding the effects of the IMO sulphur cap on ICU performance, maintenance and lifetime service.



## 4 Findings

---

- 4.1 The engineers identified a fault with the main engine during pre-departure testing, but they did not confirm it was rectified before departing port.
- 4.2 The *Funing's* main engine was unable to generate full power because a fuel injection control unit for the number two engine cylinder was malfunctioning, and the cylinder was not firing.
- 4.3 A weakness in communication between the master and chief engineer meant the bridge team were not fully aware of the problem with the main engine, or its implications.
- 4.4 The problem with the main engine was not accounted for during the bridge team's pre-departure checks, and therefore they were unable to relay it to the pilot during the master-pilot exchange of information.
- 4.5 The environmental conditions on the day were at the upper end of the environmental limits imposed by Port of Tauranga's safety management plan. The limits were based on a vessel being fully manoeuvrable, which was not the case on this occasion.
- 4.6 The main engine fault was very likely due to the injection control valve being unable to move because it had become seized with coking debris caused by the effect of low-sulphur fuel, which interfered with the operation of the valves.
- 4.7 There was no single, comprehensive document available to the vessel's engineers to address the effects of low-sulphur fuel on injection control unit maintenance.

## 5 Safety issues and remedial action

---

### **General**

- 5.1 Safety issues are an output from the Commission's analysis of factors that have contributed to the occurrence. They typically describe a system problem that has the potential to adversely affect future operations on a wide scale.
- 5.2 Safety issues may be addressed by safety actions taken by a participant, otherwise the Commission may issue a recommendation to address the issue.
- 5.3 Recommendations are made to persons or organisations that are considered the most appropriate to address the identified safety issues.
- 5.4 In the interests of transport safety, it is important that safety actions are taken, or any recommendations are implemented, without delay to help prevent similar accidents or incidents occurring in the future.

### ***Ineffective bridge and engine room resource management***

- 5.5 Ineffective communication between the master and chief engineer meant the master was not fully aware of the malfunctioning main engine prior to the vessel departing its berth.
- 5.6 Thome Ship Management has introduced procedures to regulate communication between the master and chief engineer to ensure all safety-critical information is communicated between them.

### ***The defined environmental conditions for departure were marginal***

- 5.7 The vessel's main engine malfunction combined with the prevailing environmental conditions exceeded the safety considerations in the pilotage plan, and the vessel's navigational control was rendered ineffective.
- 5.8 Port of Tauranga has made the following changes:

Port of Tauranga has made changes to its safety management system that have resulted in changes to our existing Wind SOP (reduction of max wind) and the creation of a High Swell event SOP and resulted in regular Tug Escorting. Additionally, we have committed to increased training for Pilots and Tug Masters with respect to emergency response as incorporating our findings into the future procurement of tugs and tug equipment.

Our analysis determines that the incident of an [sic] vessel suffering [main engine] failure in the entrance whilst unescorted has reduced from 1/1000 to 1/7000.

### ***The engine manufacturer's maintenance information was not fully understood by end-users***

- 5.9 The introduction of low-sulphur fuel has had a significant effect on the performance of marine diesel engines. Although Wärtsilä had provided guidance, in various documents, on the effects of using low-sulphur fuels in its ICUs, this had not been fully integrated into the vessel's safety management and planned maintenance systems.
- 5.10 Thome Ship Management has provided the Commission with a copy of its amended safety management system documentation, which will ensure it captures all the

maintenance and safety publications received from equipment manufacturers and that any relevant information is integrated into its safety management system.

## 6 Recommendation

---

- 6.1 The Commission issues recommendations to address safety issues found in its investigations. Recommendations may be addressed to organisations or people, and can relate to safety issues found within an organisation or within the wider transport system that have the potential to contribute to future transport accidents and incidents.
- 6.2 In the interests of transport safety, it is important that recommendations are implemented without delay to help prevent similar accidents or incidents occurring in the future.
- 6.3 The introduction of low-sulphur fuel has had a significant effect on the performance of marine diesel engines. Although Wärtsilä had provided guidance on the effects of using low-sulphur fuels in its ICUs, documentation on all possible effects has become separated over time and there was no single, comprehensive guidance document available to the vessel's engineers to address all the effects of low-sulphur fuel on ICU maintenance.
- 6.4 **The Commission has made a recommendation to Wärtsilä that it take further steps to help ensure users of its RT-Flex engines are fully aware of all the effects of the IMO sulphur cap and its operational effects on ICU performance, maintenance and lifetime service. (010/21)**

## 7 Key lessons

---

- 7.1 BRM and ERM represent critical functionality and communication that are applied not only individually within the two departments but also jointly between departments. They are often referred to as maritime resource management.
- 7.2 Equipment manufacturers' instructions and guidance documents can be safety critical. Those responsible for producing safety management system documents should ensure that, after their publication, such documents and information are made readily available and as easy as practicable to assimilate into safety management systems by those responsible for the maintenance of such equipment.

## 8 Data summary

---

### ***Funing* particulars**

Name:	<i>Funing</i>
Type:	bulk carrier
Class:	Lloyd's Register
Limits:	unlimited
Classification:	LR100A1, Bulk Carrier, CSR
Length:	179.99 metres
Breadth:	30 metres
Gross tonnage:	23,703
Built:	2015
Propulsion:	Wärtsilä HHM 5RT-Flex 50B coupled to a single propeller
Owner:	The China Navigation Company Pte. Ltd.
Manager:	Thome Ship Management Pte. Ltd.
Port of registry:	Singapore
Date and time	5 July 2020, 0048
Location	'B' buoy, main channel to the Port of Tauranga
Damage	bent rudder stock and damaged propeller blade



## 9 Conduct of the inquiry

---

- 9.1 On 6 July 2020, Maritime New Zealand notified the Commission of an accident that had occurred involving a bulk carrier at the Port of Tauranga. Circumstances reported were that the vessel *Funing* had lost power while departing Port of Tauranga and was positioned at 'B' buoy with anchors deployed.
- 9.2 On the same day the Commission opened an inquiry under section 13(1)b of the Transport Accident Investigation Commission Act 1990 and appointed an investigator in charge.
- 9.3 A protection order (202/01 2020) was placed on the vessel to protect evidence and prohibit its departure. The protection order applied from 6 July 2020 to 9 July 2020.
- 9.4 The Chief Investigator of Accidents notified the vessel's port of registry, Singapore. The Transport Safety Investigation Bureau of Singapore established its interest as a Substantially Interested State.
- 9.5 On 6 July three investigators travelled to Tauranga to collect evidence. Another investigator travelled there on 7 July. They all returned to Wellington on 9 July.
- 9.6 The vessel was at anchor at the entrance to Port of Tauranga. Three investigators boarded the vessel and conducted interviews.
- 9.7 A malfunctioning ICU was removed from the vessel's main engine and transferred to the Commission's storage facility in Wellington.
- 9.8 On 28 July two investigators returned to Tauranga for one day to conduct further interviews and gather evidence.
- 9.9 On 29 April and 4 May 2021 the ICU was inspected at Quest Integrity for an engineering analysis of the cause of its malfunction. Det Norske Veritas (Norway) provided subject expertise on the analysis of the ICU.
- 9.10 On 11 August investigators, with the assistance of Transport Safety Investigation Bureau of Singapore, met with a representative from Wärtsilä, and also had another meeting with representatives from the vessel's owner and manager.
- 9.11 On 25 August 2021 the Commission approved a draft report for circulation to eight interested persons for their comment.
- 9.12 Submissions were received from seven interested persons. Any changes as a result of these submissions have been included in the final report.
- 9.13 On 8 December 2021 the Commission approved the final report for publication.

## 10 Report information

---


### ***Abbreviations***

BRM	bridge resource management
ERM	engine room resource management
FCM-20	Flex Control Module
ICU	injection control unit
IMO	International Maritime Organization
OOW	officer of the watch
SOPs	safe operating procedures
STCW Code	Seafarers' Training, Certification and Watchkeeping Code
STCW Convention	International Convention on Standards of Training, Certification and Watchkeeping for Seafarers
WECS	Wärtsilä engine control system


## **Glossary**

coking	a process where oil heated to high temperatures in the absence of oxygen releases all the volatile components. A hard and strong high-carbon material named coke is left behind
drag	a mechanical force that results from the interaction of a solid body with a fluid. Drag acts in opposition to the direction of the propelling force
ebb (tide)	an outgoing tide
knot	one knot is equal to 1.852 kilometres per hour
telegraph	A telegraph is a communications device used by a bridge team to give main-engine orders to a vessel's main engine

# Appendix 1 Thome Ship Management Pte. Ltd. pilot card

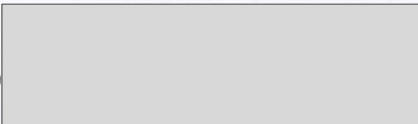Radars operational and ready	3 cm	Yes	Indicators operational / ready	RPM / Pitch	Yes
	10 cm	Yes		Rudder Angle	Yes
	ARPA	Yes		Rate of Turn	Yes
Manoeuvring Data made available to Pilot	Yes		VHF operational and ready		Yes
Squat Data made available to Pilot	Yes		Whistle(s) Tested and Operational		Yes
<b>Anchors</b>					
Port:	11 shackles	Ready	Yes	Starboard:	12 shackles
					Ready
Maximum Permissible Bollard Pull from Tugs: <b>628KN</b>					
Are anchors checked and ready for use: <b>YES</b>					
<b>Steering Gear</b>					
Is steering Gear checked and ready for use:					
Type of Rudder	SEMI-SPADE		BECKER RUDDER: Max Angle 70°		
Max Angle	35 degrees		Number of power units operating		2 unit
Rudder angle for neutral effect	0.2 degrees		Thrusters (Position and Power)		N/A
Hard-over to hard-over	27.28(1)13.85(2) seconds		Steering Characteristics		RIGHT HANDED
<b>Main Propulsion Details</b>					
No. of Propellers: 1	Direction of Turn: Right		Propeller Arrangement		
Main Engine Type	Steam Turbine / Motor	Engine Order	RPM / Pitch	Speed (knots)	
				Laden	Ballast
Max Shaft Power	6050 kW / HP	Full Ahead	68	10.5	11.5
Astern Power is	70% Ahead Power	Half Ahead	48	7.6	8.7
Time Limit Astern	600 Seconds	Slow Ahead	40	6.4	7.6
Full Ahead to Full Astern	182 Seconds	Dead Slow Ahead	30	4.9	6.1
Max No. of Consecutive Starts	8 Starts	Dead Slow Astern	30	1.9	2.7
Critical RPM	51-63 RPM	Slow Astern	40	2.9	3.5
Minimum RPM	24 RPM	Half Astern	48	3.7	4.3
Speed at Minimum RPM	4.9 Knots	Full Astern	68	4.9	5.5
Minimum Steering Speed	3-4 kts	Maximum ahead speed below which astern movement can be given	5 kts		
Bridge control / ER control	Engine telegraphs operational	Yes / No	Engines tested Ahead/Astern		
			Yes / No		
Are mooring winches and lines checked and ready for use: <b>YES</b>					
Equipment operational defects					
NIL					
Other Important Details					
NIL					
<b>Print Name, Sign and time of completion</b>					
Master:			Pilot (for receipt only):		
					

## Appendix 2 Port of Tauranga passage plan



**PORT OF  
TAURANGA**

### PASSAGE PLAN

Date: 06-07-20

Vessel Name: Fanning

Last / Next Port: Larshan (China)

To / From Berth No: 9 Port / Stb Stb

**Checklist:**

	Yes	No
Pilot Card Presented	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Any deficiencies / characteristics that may influence passage plan	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Any Main Engine Maintenance carried out / to be carried out in Port of Tauranga?	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Anchors Cleared	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Other V/L Movements	<input checked="" type="checkbox"/>	<input type="checkbox"/>

Word set back (Pilot Station)

**The Pilot expects to be monitored by the bridge team and also questioned should any orders not be fully understood.**

**Predicted Tide:**

Time	Height

**Tidal Window:**

Class	From	To
<u>C</u>		

**Predicted Rate of Current @ Entrance:**


Time	Rate
<u>0030</u>	<u>2.5 Ebb</u>
<u>0715</u>	<u>0.2 Flood</u>

**Wind:**

	Direction	Speed
Present	<u>NONE</u>	<u>30</u>
Forecast	<u>N 35 G 45</u>	<u>↓ N 20</u>

**Mooring Plan:**

B/T=

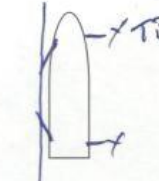

S/T=

**Clearance**

Fwd 29

Aft 513

**TUGS**

Sir Robert 50T

Tai Pari 70T

Tai Timu 70T

**Draft Calculations:**

Outer Channel	Inner Channel	At Berth
Depth <u>15.8</u>	Depth <u>14.5</u>	Draft Allowable at Berth <u>12.0</u>
Height of tide <u>0.4</u>	Height of tide <u>0.4</u>	V/L Draft <u>12.7</u>
<u>16.2</u>	<u>14.9</u>	
- V/L Draft <u>6.7</u>	- V/L Draft <u>6.7</u>	
<u>5.5</u>	UKC <u>4.2</u>	
- Squat <u>-1.0</u>		
<u>4.5</u>		
- Swell <u>1/2</u> <u>-1.8</u>		
UKC <u>2.7</u>		

Minimum UKC of ≥10% of draft throughout transit

Y
N

Master Name: [REDACTED]

Master Signature: [REDACTED]

Pilot Name: [REDACTED]

Pilot Signature: [REDACTED]

PurePrint 576 3183

Final Report MO-2020-202 | Page 34

## Appendix 3 Summary of Wärtsilä documents providing guidance on ICU maintenance that were available to the Commission

Year of publication	Document name	Summary of guidance																		
2008	RT-155 Reconditioning of Injection Control Unit	<p>In case of ICU malfunction, the options for on-board problem solving are normally limited to replacement of the Rail Valves, Fuel Quantity Sensor and Fuel Quantity Piston. If further measures are required, the complete ICU, including Rail Valves and Fuel Quantity Sensor/Piston, should be sent for repair or reconditioning.</p> <p>After long-term operation the internal drain bores of the Injection Control Block may become clogged with carbon deposits. Due to pressure building up in these drain bores, this may ultimately result in external leakages. The ICU will then have to be sent for repair.</p>																		
2010	RT-85 Injection control unit with new drain pipe arrangement	new ICUs are equipped with two draining pipe connections related to leakage																		
2014	RT-175 Trouble shooting and maintenance on ICU	<p>Section 5.0 description of failure messages:</p> <table border="1"> <tr> <td rowspan="4"> <p>6</p> <p>"ME Injection quantity piston fail. Cylinder #[T] (ID 93)" together with: "ME Inj. Quantity Piston, Stuck In Max. Pos. (Inj.cut-off+SLD) (ID 92)"</p> <p>– Fuel quantity piston has remained in max position when cylinder piston is at BDC. FQ sensor signal is above 18 mA. Injection for this unit is cut off and return command to rail valve are sent every second until fuel quantity piston returns or max 120 s. Alarm is sound after 30 s with a slowdown request to AMS.</p> </td><td>– Fuel quantity piston stuck due to deposits on the rod (during engine start after the fuel nozzle exchange)</td><td>– Check and clean fuel quantity piston rod</td></tr> <tr> <td>– High fuel viscosity</td><td>– Ventilation of injection pipe (after dismantling)</td></tr> <tr> <td>– Rail valve failure</td><td>– Check fuel oil temperature</td></tr> <tr> <td>– Insufficient closing of one of more ICV's (in worst case on ICV is stuck in open position)</td><td>– Check trace heating</td></tr> <tr> <td></td><td></td><td>– Check on time rail valve return</td></tr> <tr> <td></td><td></td><td>– Exchange of rail valve</td></tr> <tr> <td></td><td></td><td>– Exchange of ICU</td></tr> </table> <p>Section 6.2 cleaning fuel quantity piston rod  Section 6.3 changing fuel quantity sensor  Section 6.4 returning stuck fuel quantity piston  Section 6.5 cleaning replacement throttle screw  Section 6.6 replace ICV  Section 6.7 return ICU to Wärtsilä warehouse</p>	<p>6</p> <p>"ME Injection quantity piston fail. Cylinder #[T] (ID 93)" together with: "ME Inj. Quantity Piston, Stuck In Max. Pos. (Inj.cut-off+SLD) (ID 92)"</p> <p>– Fuel quantity piston has remained in max position when cylinder piston is at BDC. FQ sensor signal is above 18 mA. Injection for this unit is cut off and return command to rail valve are sent every second until fuel quantity piston returns or max 120 s. Alarm is sound after 30 s with a slowdown request to AMS.</p>	– Fuel quantity piston stuck due to deposits on the rod (during engine start after the fuel nozzle exchange)	– Check and clean fuel quantity piston rod	– High fuel viscosity	– Ventilation of injection pipe (after dismantling)	– Rail valve failure	– Check fuel oil temperature	– Insufficient closing of one of more ICV's (in worst case on ICV is stuck in open position)	– Check trace heating			– Check on time rail valve return			– Exchange of rail valve			– Exchange of ICU
<p>6</p> <p>"ME Injection quantity piston fail. Cylinder #[T] (ID 93)" together with: "ME Inj. Quantity Piston, Stuck In Max. Pos. (Inj.cut-off+SLD) (ID 92)"</p> <p>– Fuel quantity piston has remained in max position when cylinder piston is at BDC. FQ sensor signal is above 18 mA. Injection for this unit is cut off and return command to rail valve are sent every second until fuel quantity piston returns or max 120 s. Alarm is sound after 30 s with a slowdown request to AMS.</p>	– Fuel quantity piston stuck due to deposits on the rod (during engine start after the fuel nozzle exchange)	– Check and clean fuel quantity piston rod																		
	– High fuel viscosity	– Ventilation of injection pipe (after dismantling)																		
	– Rail valve failure	– Check fuel oil temperature																		
	– Insufficient closing of one of more ICV's (in worst case on ICV is stuck in open position)	– Check trace heating																		
		– Check on time rail valve return																		
		– Exchange of rail valve																		
		– Exchange of ICU																		
2015	RT-146 Rail valve leakage	This Technical Bulletin describes the causes and effects of O-rings that do not seal correctly on the rail valves. This Technical Bulletin also gives the recommended actions to identify and prevent the problems and solutions.																		



2019	RT-229 Operation guidance to the global sulphur cap 2020	<p>Table of contents:</p> <ul style="list-style-type: none"> <li>1.0 Introduction</li> <li>2.0 Fuel specification and handling guidance <ul style="list-style-type: none"> <li>2.1 Fuel specification and handling</li> <li>2.2 Fuel bunkering and storage</li> <li>2.3 Fuel oil treatment</li> </ul> </li> <li>3.0 Engine component design considerations</li> </ul> <p>Using fuel with low viscosity, an increased leakage in the fuel injection system will occur compared to HSFO operation. The leakage rate is increased inversely proportional to the viscosity, i.e. it can be five times higher with a reduction in fuel viscosity from 15 to 3 CentiStokes (cSt).</p> <p>Furthermore, during an operation period of some years, there will be an increase in the clearance because of wear of components. Incorrect fuel treatment on board or insufficient quality of fuel can accelerate the wear rate. Small increase of clearance, however, will cause greater leakage flow compared to new components. The leakage flow is proportional to cubed clearance and could require earlier replacement of the components.</p> <p>Leakage flow = (clearance)<sup>3</sup></p> <p>The internal leakage on fuel related equipment can be measured directly on the single parts. Alternately, the rail pressure drop trend in the flexView at engine stop gives an indication of the quantity of internal leakage. It is recommended to periodically check the rail pressure drop at engine stop when running on VLSFO or after maintenance of fuel injection components.</p> <p>Note:</p> <p>It is therefore essential to maintain optimal condition of the different fuel injection components during VLSFO in use. An assessment of fuel system and injection components as well as engine performance evaluation by Wärtsilä Services is highly recommended.</p> <p>3.1 Engine component design</p> <p>ICU</p> <p>The implications of using low viscosity fuel in the ICU vary depending on engine and ICU type. On small bore ICUs starting difficulties were often reported due to worn ICV whereas big bore ICUs reported more exhaust gas temperature alarms caused by premature wear of the ICU valve seat.</p> <p>ICU small/medium bore (engine starting difficulties)</p>
------	---	--

		<p>Leakage rates from individual ICUs should be measured together with fuel viscosity information to record a trend of the leakage development. As general guidance, leakage rates of above 200 ml/min on respective ICUs during ULSFO in use are an indication for worn ICUs.</p> <p>ICU big bore</p> <p>In order to ensure safe engine operation while continuously operating on low viscosity fuel, it is recommended to reduce the TBO of concerned ICUs by about 30%</p> <p>4.0 Impact to the engine combustion</p> <p>5.0 Recommendation for piston running</p> <p>6.0 References and useful links:</p> <p>7.0 Contacts</p>																						
2019	Operating 2-stroke engines in compliance with the global sulphur cap 2020 Business white paper	<p>Operating with heavy fuel oil (HFO) results in wear of running parts, while switching between fuels and mixing incompatible fuels can impact component lifetime. Continuous operation with HFO will result in the standard TBO being achieved.</p> <p>When switching to clean low-sulphur fuels with low viscosity, the efficiency or the function of the injection components might be affected.</p>																						
	RT-123_A2 Wartsila data and specifications for inspection or overhaul intervals	<table><tr><th>Component</th><th>Inspection or Overhaul interval<sup>(1)</sup> [RH: Running Hours]</th><th>Estimated lifetime<sup>(1, 2)</sup> [RH: Running Hours]</th><th>Comments</th><th>Maintenance methods</th></tr><tr><td rowspan="4">Injection control unit (ICU)</td><td></td><td>24,000</td><td>Only ICUs on engines built before 2011, which have not been remanufactured.</td><td>Remanufacturing</td></tr><tr><td></td><td>36,000</td><td>Applies to ICUs on engines built from 2011 onwards and to the already remanufactured ICUs on engines built before 2011.</td><td>Remanufacturing</td></tr><tr><td>Filter: 18,000</td><td></td><td>Clean and check filter condition. Replace only if required.</td><td>Replacement</td></tr><tr><td>Rail valve: Monitored</td><td></td><td>Check "on-time" of rail valves through flexView and replace if "on-time" &gt; 2.6 ms.</td><td>Replacement</td></tr></table>	Component	Inspection or Overhaul interval <sup>(1)</sup> [RH: Running Hours]	Estimated lifetime <sup>(1, 2)</sup> [RH: Running Hours]	Comments	Maintenance methods	Injection control unit (ICU)		24,000	Only ICUs on engines built before 2011, which have not been remanufactured.	Remanufacturing		36,000	Applies to ICUs on engines built from 2011 onwards and to the already remanufactured ICUs on engines built before 2011.	Remanufacturing	Filter: 18,000		Clean and check filter condition. Replace only if required.	Replacement	Rail valve: Monitored		Check "on-time" of rail valves through flexView and replace if "on-time" > 2.6 ms.	Replacement
Component	Inspection or Overhaul interval <sup>(1)</sup> [RH: Running Hours]	Estimated lifetime <sup>(1, 2)</sup> [RH: Running Hours]	Comments	Maintenance methods																				
Injection control unit (ICU)		24,000	Only ICUs on engines built before 2011, which have not been remanufactured.	Remanufacturing																				
		36,000	Applies to ICUs on engines built from 2011 onwards and to the already remanufactured ICUs on engines built before 2011.	Remanufacturing																				
	Filter: 18,000		Clean and check filter condition. Replace only if required.	Replacement																				
	Rail valve: Monitored		Check "on-time" of rail valves through flexView and replace if "on-time" > 2.6 ms.	Replacement																				
2019	In Detail 02  "Who's afraid of the sulphur cap?"	<p><b>"Combating leaks</b></p> <p>On the two-stroke low-speed engines' side, Nanda lists leakage and premature wear and tear on the components, as the biggest concerns involved in switching to low sulphur fuel.</p> <p>"Low-viscosity fuel leads to a higher leakage rate in the injection equipment, which can result in engine starting difficulties or slowdown due to insufficient pressure in the fuel injection system. Furthermore, the high leakage rate needs to be handled by the drain fuel system.""</p> <p>The paper outlines the risks and issues associated with low sulphur fuels, also recommends and outlines various solutions and upgrades to ensure operation on low sulphur fuels.</p>																						



## Kōwhaiwhai - Māori scroll designs

TAIC commissioned its four kōwhaiwhai, Māori scroll designs, from artist Sandy Rodgers (Ngāti Raukawa, Tūwharetoa, MacDougal). Sandy began from thinking of the Commission as a vehicle or vessel for seeking knowledge to understand transport accident tragedies and how to avoid them. A 'waka whai mārama' (i te ara haumarū) is 'a vessel/vehicle in pursuit of understanding'. Waka is a metaphor for the Commission. Mārama (from 'te ao mārama' – the world of light) is for the separation of Rangitāne (Sky Father) and Papatūānuku (Earth Mother) by their son Tāne Māhuta (god of man, forests and everything dwelling within), which brought light and thus awareness to the world. 'Te ara' is 'the path' and 'haumarū' is 'safe' or 'risk free'.

### **Corporate: Te Ara Haumarū - the safe and risk free path**



The eye motif looks to the future, watching the path for obstructions. The encased double koru is the mother and child, symbolising protection, safety and guidance. The triple koru represents the three kete of knowledge that Tāne Māhuta collected from the highest of the heavens to pass their wisdom to humanity. The continual wave is the perpetual line of influence. The succession of humps represents the individual inquiries.

Sandy acknowledges Tāne Māhuta in the creation of this Kōwhaiwhai.

### **Aviation: Ngā hau e whā - the four winds**



To Sandy, 'Ngā hau e whā' (the four winds), commonly used in Te Reo Māori to refer to people coming together from across Aotearoa, was also redolent of the aviation environment. The design represents the sky, cloud, and wind. There is a manu (bird) form representing the aircraft that move through Aotearoa's 'long white cloud'. The letter 'A' is present, standing for a 'Aviation'.

Sandy acknowledges Ranginui (Sky father) and Tāwhirimātea (God of wind) in the creation of this Kōwhaiwhai.

### **Maritime: Ara wai - waterways**



The sections of waves flowing across the design represent the many different 'ara wai' (waterways) that ships sail across. The 'V' shape is a ship's prow and its wake. The letter 'M' is present, standing for 'Maritime'.

Sandy acknowledges Tangaroa (God of the sea) in the creation of this Kōwhaiwhai.

### **Rail: rerewhenua - flowing across the land**



The design represents the fluid movement of trains across Aotearoa. 'Rere' is to flow or fly. 'Whenua' is the land. The koru forms represent the earth, land and flora that trains pass over and through. The letter 'R' is present, standing for 'Rail'.

Sandy acknowledges Papatūānuku (Earth Mother) and Tāne Mahuta (God of man and forests and everything that dwells within) in the creation of this Kōwhaiwhai.



## Transport Accident Investigation Commission

***Recent Maritime Occurrence reports published by  
the Transport Accident Investigation Commission  
(most recent at top of list)***

MO-2018-206	Bulk carrier Alam Seri, loss of control and contact with seabed, Port of Bluff, 28 November 2018
MO-2020-201	Collision between bulk carrier Rose Harmony and fishing vessel Leila Jo, Off Lyttelton, 12 January 2020
MO-2019-204	Capsize of water taxi Henerata, Paterson Inlet, Stewart Island/Rakiura, 12 September 2019
MO-2019-203	Bulk log carrier Coresky OL, Crew fatality during cargo-securing operation, Eastland Port, Gisborne, 3 April 2019
MO-2018-205	Fatality on board the factory trawler San Granit, 14 November 2018
MO-2019-202	Fatal jet boat accident, Hollyford River, Southland, 18 March 2019
MO-2019-201	Jet boat Discovery 2, contact with Skippers Canyon wall, 23 February 2019
MO-2018-202	Accommodation fire on board, fishing trawler Dong Won 701, 9 April 2018
MO-2018-203	Grounding of container ship Leda Maersk, Otago Lower Harbour, 10 June 2018
MO-2018-204	Dolphin Seeker, grounding, 27 October 2018
MO-2017-204	Passenger vessel Seabourn Encore, breakaway from wharf and collision with bulk cement carrier at Timaru, 12 February 2017
MO-2017-203	Burst nitrogen cylinder causing fatality, passenger cruise ship Emerald Princess, 9 February 2017
MO-2017-205	Multipurpose container vessel Kokopo Chief, cargo hold fire, 23 September 2017
MO-2017-202	Passenger vessel L'Austral, grounding, Milford Sound, Fiordland, 9 February 2017
MO-2016-206	Capsize and foundering of the charter fishing vessel Francie, with the loss of eight lives, Kaipara Harbour bar, 26 November 2016







Price \$13.00

ISSN 1173-5597 (Print)  
ISSN 1179-9072 (Online)